# Collins | SERVICE INFORMATION LETTER

Collins Telecommunications Products Division/Sockwell International

KWM-380 TRANSCEIVER (622-5093-001, -101) HF-380 TRANSCEIVER (622-3580-001, -101)

Done pr

## SERVICE INFORMATION LETTER 2-88

### PRODUCT IMPROVEMENT

#### PURPOSE:

To improve the upper angle viewing of display A10A1

EQUIPMENT	APPLIES TO SERIAL NUMBER	PRODUCTION CUT-IN SERIAL NUMBER
KWM-380 622-5093-001, -101 HF-380	All units	NONE
622-3580-001, -101	All units	

#### SYMPTOM:

Top of digits on digital display not visible when viewed from above radio.

#### SOLUTION:

Move the display board forward 1/8 inch by changing length of display mounting posts.

- 1. Remove the dust cover to give access to the display assembly.
- Unplug the cable from the display.
- 3. Remove the three screws that mount the display board and set the display aside.
- Remove the display lens by removing the three screws that hold the lens on the radio.
  The center screw is self-tapping and the outer screws have nuts on the rear of the
  front panel.
- Replace the three hex posts that mount the display with 3/8 inch posts (Collins part # 540-9037-003) using the existing hardware.
- Mount the display board being careful not to short it against the lug on the 5 volt
  Regulator. It may be necessary to bend this lug down slightly. Plug the cable back
  onto the display.
- Replace the display lens and the dust cover after checking the display for proper operation.